

PM02 v3

Power Module



Descriptions:

PM02 is a simple way of providing your APM and Pix32 with clean power from a LiPo battery as well as current consumption and battery voltage measurements, all through a 6-pos cable. The on-board switching regulator outputs 5.2V and a maximum of 3A from up to a 12S LiPo battery. The Power Module comes completely assembled with XT60 connectors, and wrapped in shrink tubing for protection.

The GH terminal is also compatible with both Pixhawk4, Pixhawk4 mini and Durandal.


Features and Specifications:

Max input voltage: 60V
 Max current sensing: 120A
 Voltage and current measurement configured for 5V ADC
 Switching regulator outputs 5.2V and 3A max
 Weight: 20g

Package Include:

PM02 board*1
 6pin MLX cable *1
 6pin GH cable *1

Pin Map

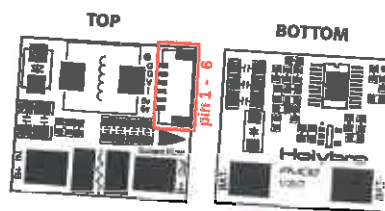

pin	Signal	Volt
1(red)	VCC	+5V
2(black)	VCC	+5V
3(black)	CURRENT	+3.3V
4(black)	VOLTAGE	+3.3V
5(black)	GND	GND
6(black)	GND	GND

Make the PM02 show the quantity of electric charge of your battery

Mission Planner setup:

1. Connect PM02 to the battery, also connect it to Mission Planner via USB.
2. Click "INITIAL SETUP" and come to the menu "Battery Monitor"

3. Make "Monitor" into "Voltage and Current".
4. Make "Sensor" into "Other".
5. Make "APM Ver" into "The Cube or Pixhawk".
6. Input "18.1" into Voltage divider (Calced).
7. Input "36" into "Amperes per volt".
8. Disconnect and reconnect it to finish the setting up. ("Measured battery voltage" shows the current quantity of electric charge of the battery.)



Holybro is a registered trademark of Holybro, registered in the U.S. and other countries.
 ©Copyright 2018 Holybro. All Rights Reserved.